

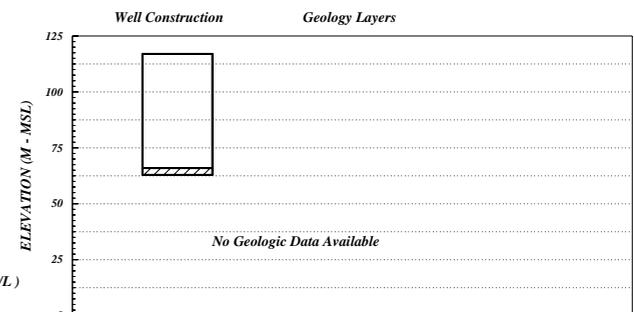
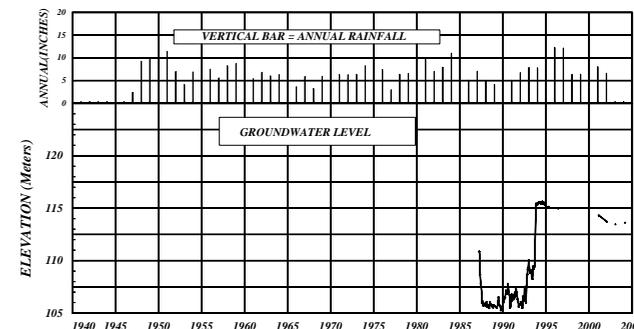
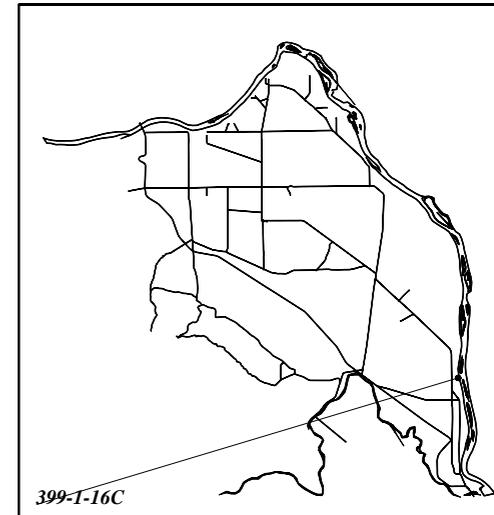


RADIONUCLIDES

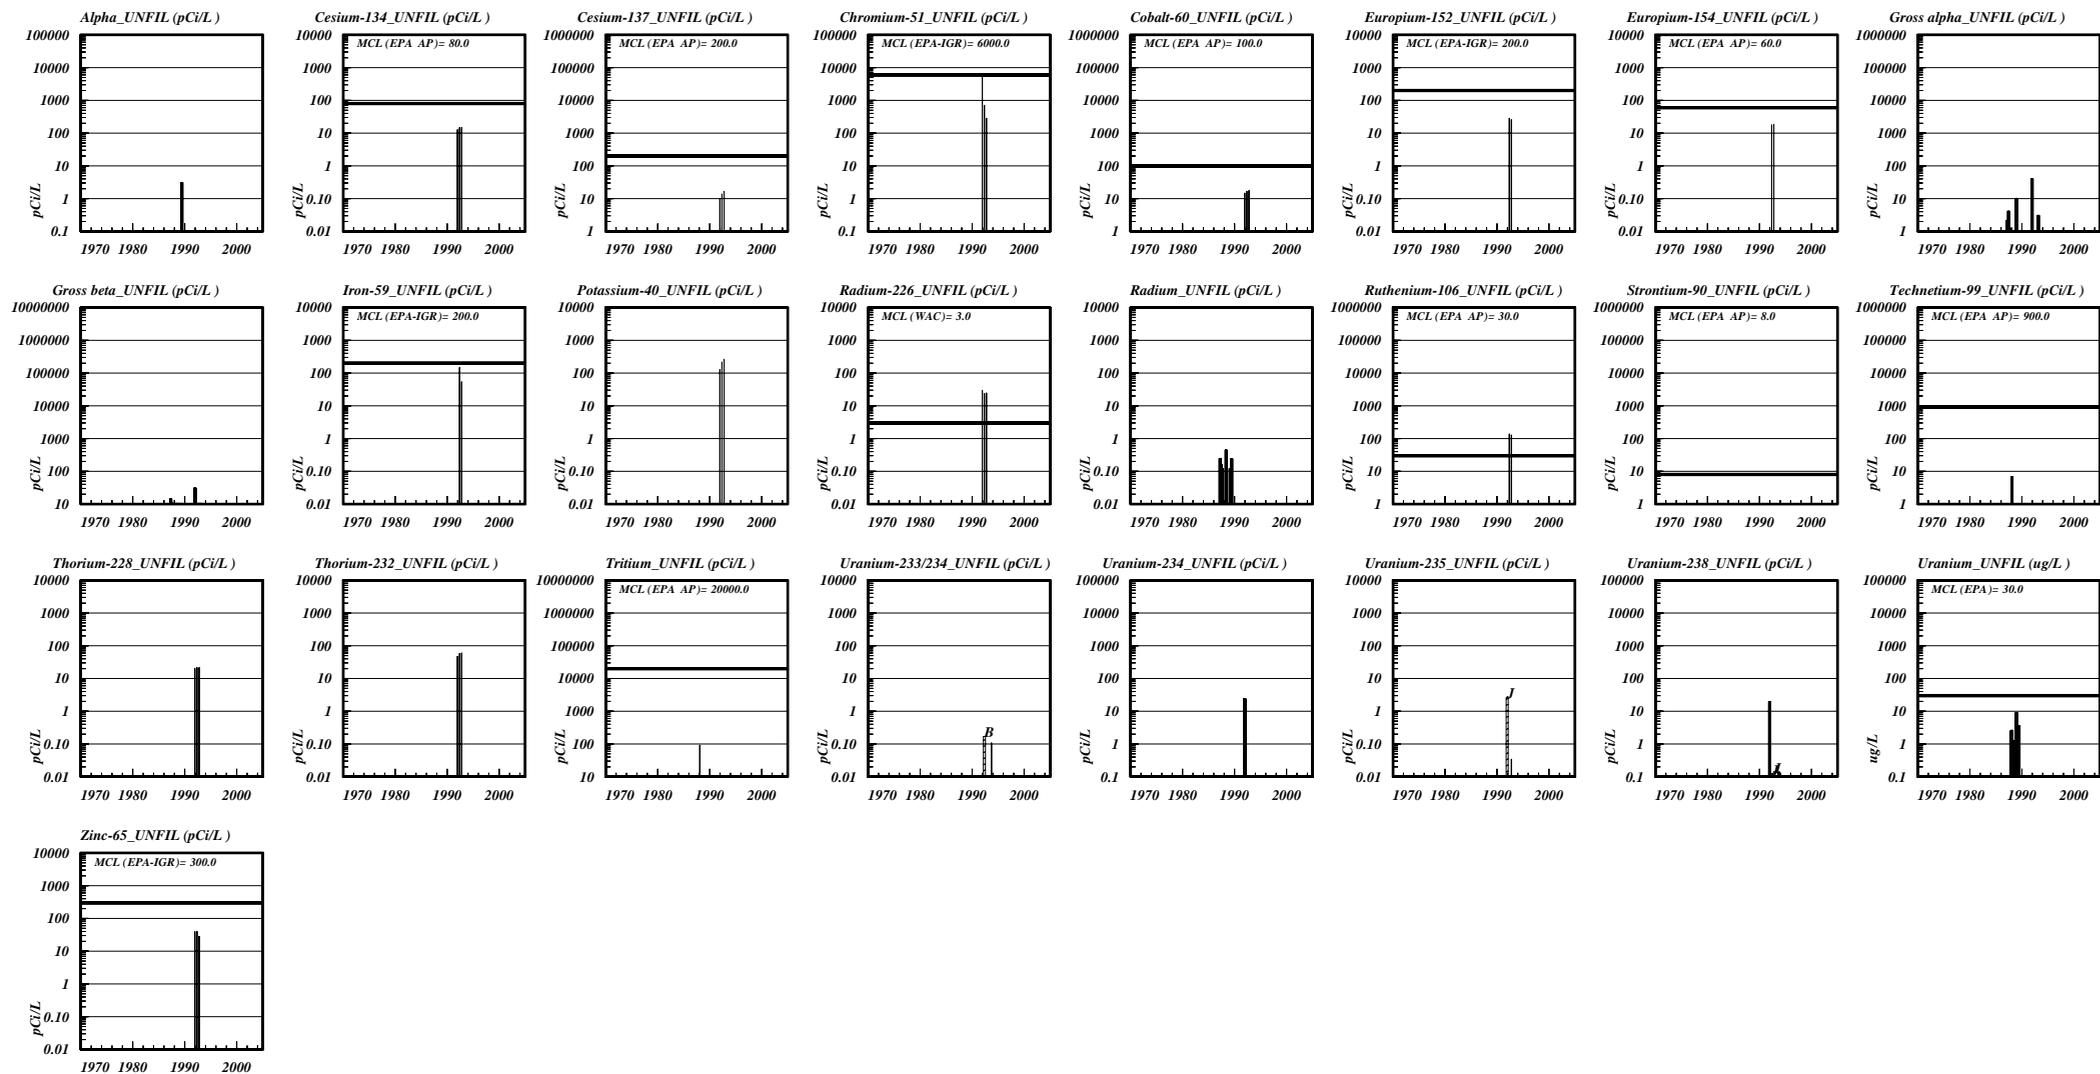

VOLATILE ORGANIC COMPOUNDS

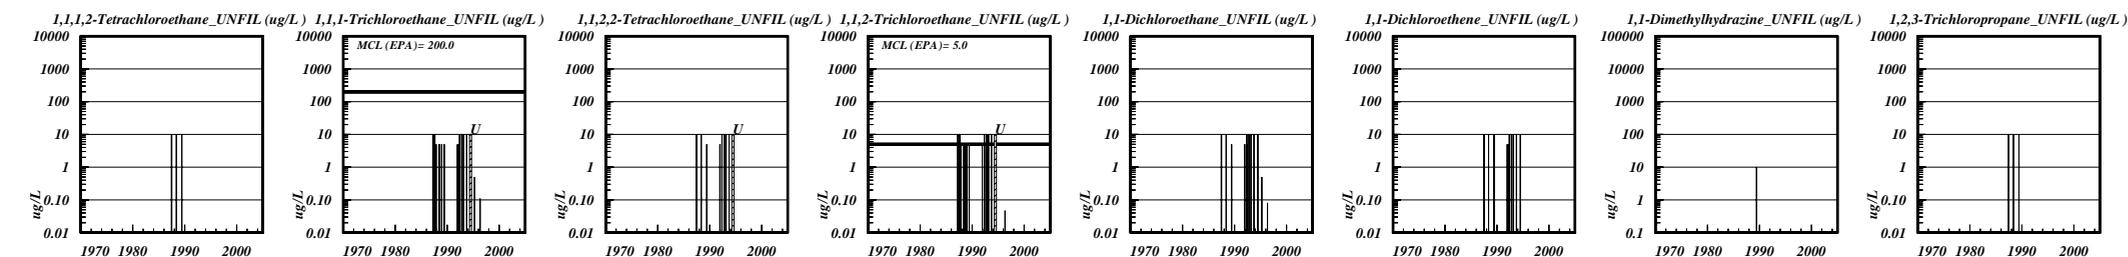


WELLNAME=399-1-16C WELLID=A5027

Well Type=STANDARD Well purpose=GROUNDWATER
 Owner=DOE Contact=BHI Well Adm Compliance=NON-COMPLIANT
 X_coord= 594312.00 Y_coord= 116410.40 Datum=NAD83(91) Date Survey=11/30/1992
 Elevation= 117.006 Datum=NAVD88 Date Survey=10/21/93
 Ref_Point_Desc=BRASS CAP Ref_Point_side=NONE Contractor=KEH
 Total Number of Screen Intervals=1
 Screen#=1 Screen_diam= 6.00 in Top= 51.05 Bottom= 54.10 m Slot_size= 0.02 in
 Screen_material=Stainless Steel
 Total Number of Seals=6
 Seal#1 Depth_top= 0.00 Bottom= 1.22 m Material=Concrete
 Seal#2 Depth_top= 1.22 Bottom= 10.67 m Material=Granular Bentonite
 Seal#3 Depth_top= 10.67 Bottom= 11.16 m Material=Bentonite Pellets
 Seal#4 Depth_top= 11.16 Bottom= 49.38 m Material=Volclay Grout
 Seal#5 Depth_top= 49.38 Bottom= 49.91 m Material=Bentonite Pellets
 Seal#6 Depth_top= 49.91 Bottom= 54.25 m Material=Sand Pack
 More Information is at <http://www.envirodataaccess.com/wellfiles/399-1-16C.htm>

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound;
 EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag


VOLATILE ORGANIC COMPOUNDS

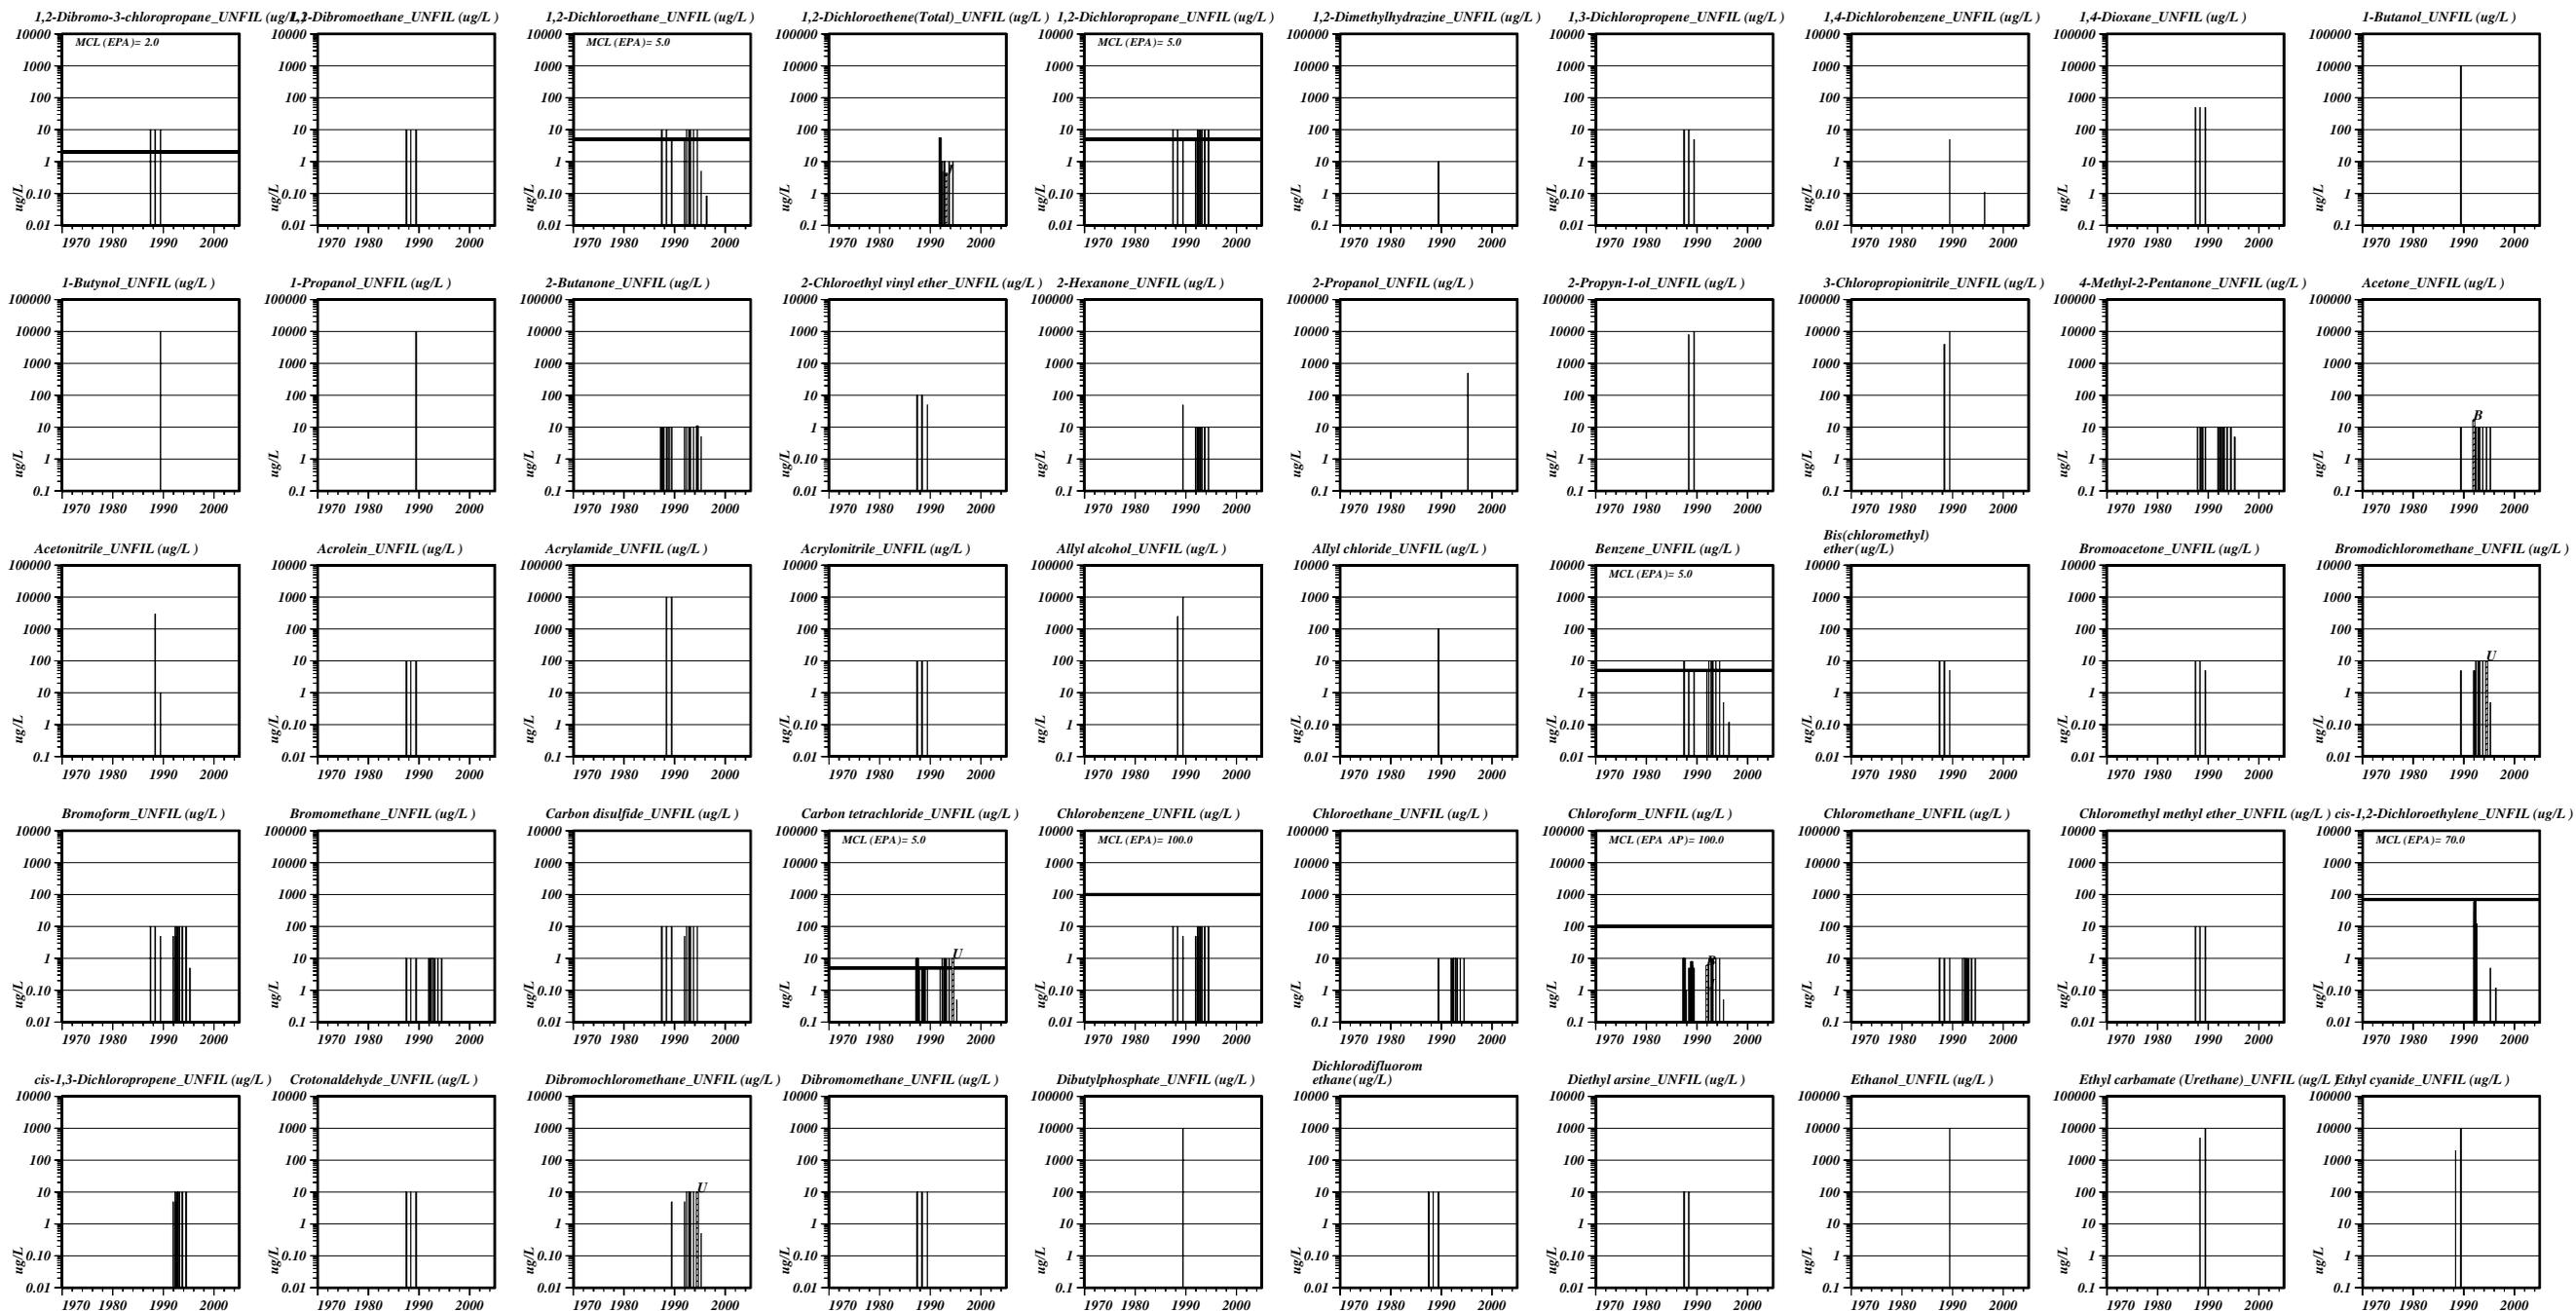


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag

VOLATILE ORGANIC COMPOUNDS

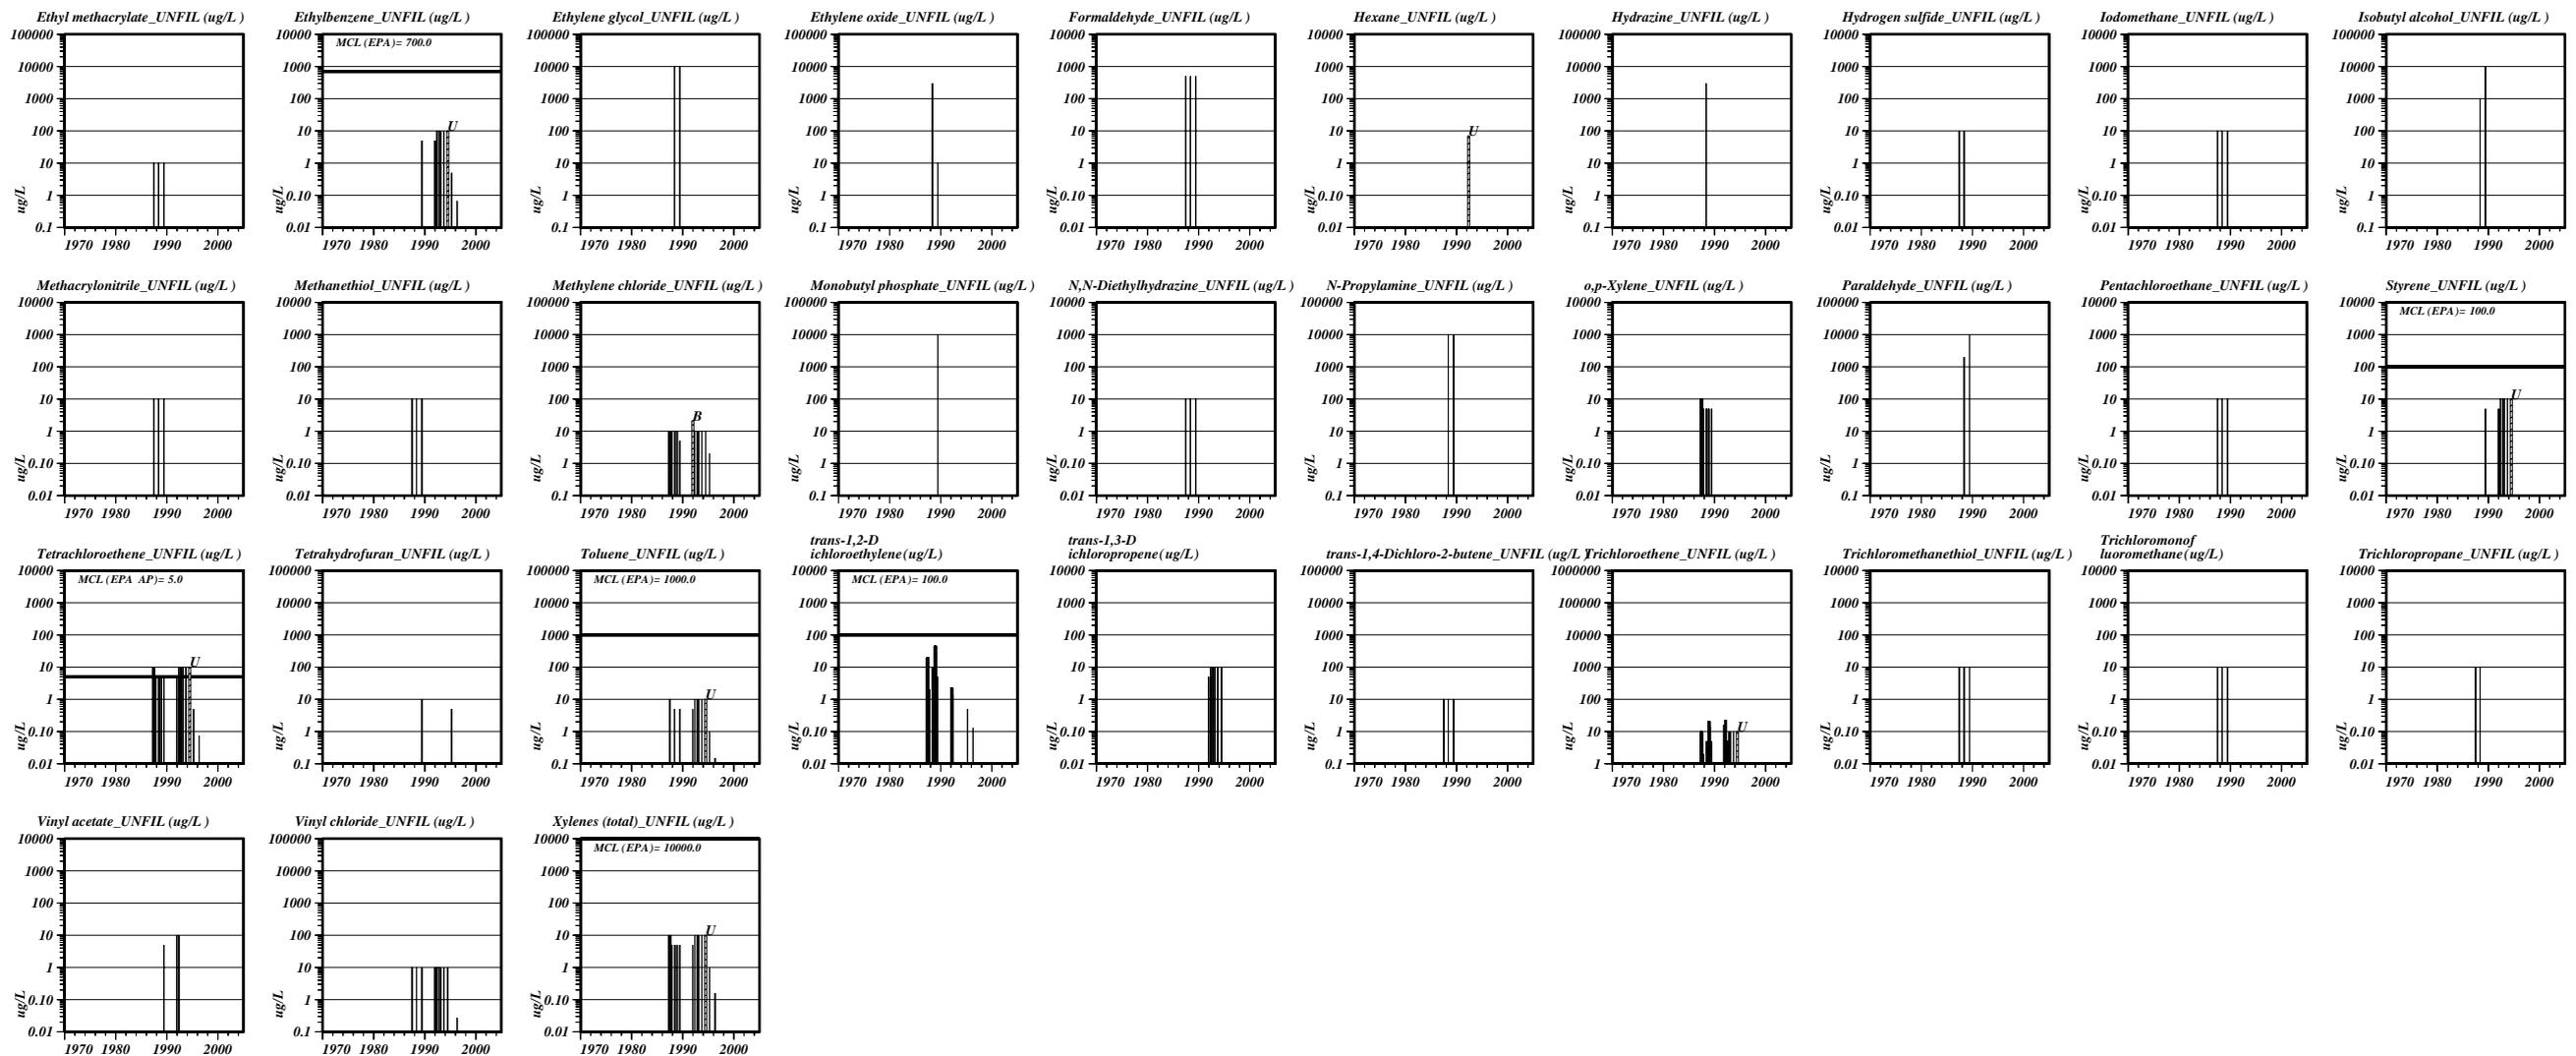


SEMI-VOLATILE ORGANIC COMPOUNDS

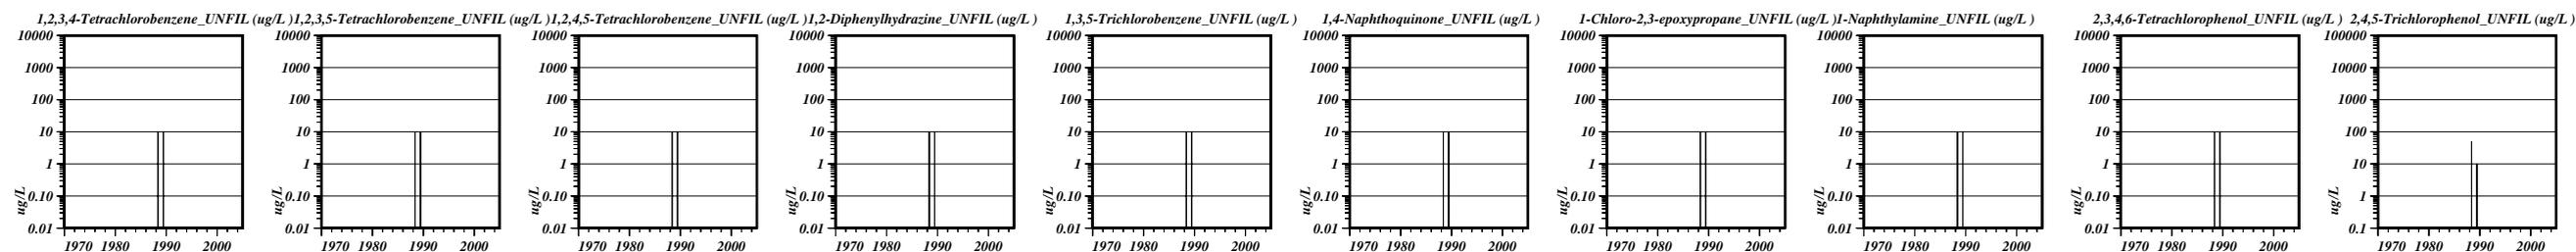

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value;L=Value between IDL and CRQL (estimated);T=Tentatively identified compound;
 EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit;THIN BARS=Value Below Detection Limit;HATCHED BARS=Value With Data Qualifier Flag


SEMI-VOLATILE ORGANIC COMPOUNDS

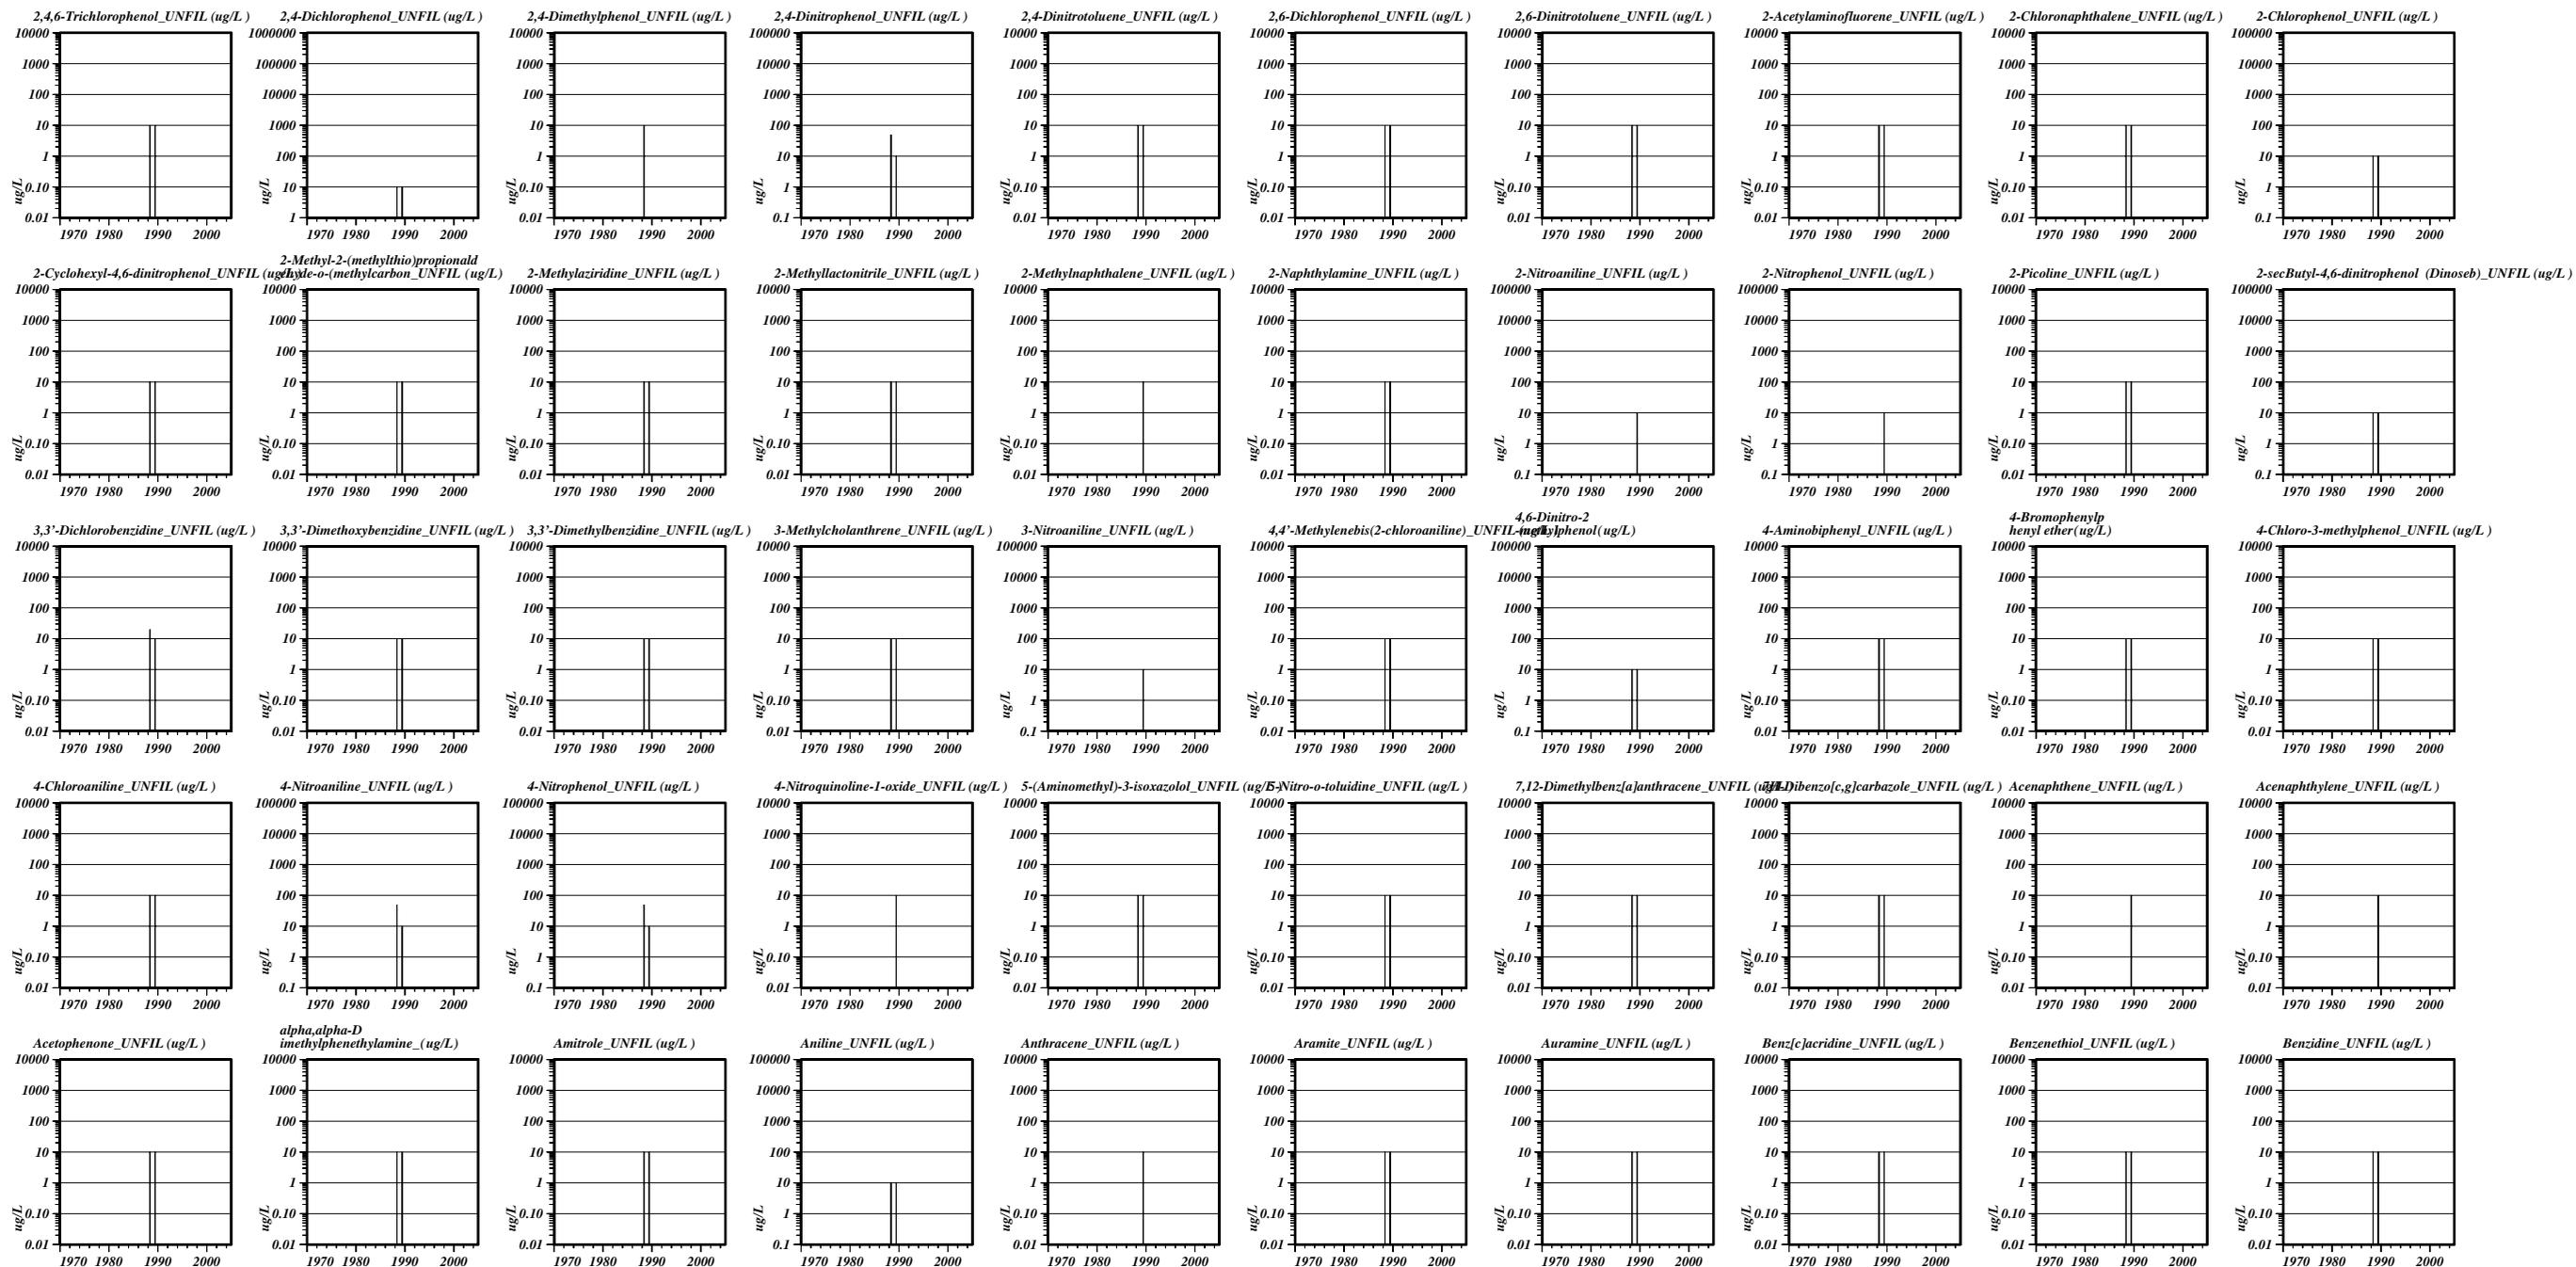

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag


SEMI-VOLATILE ORGANIC COMPOUNDS

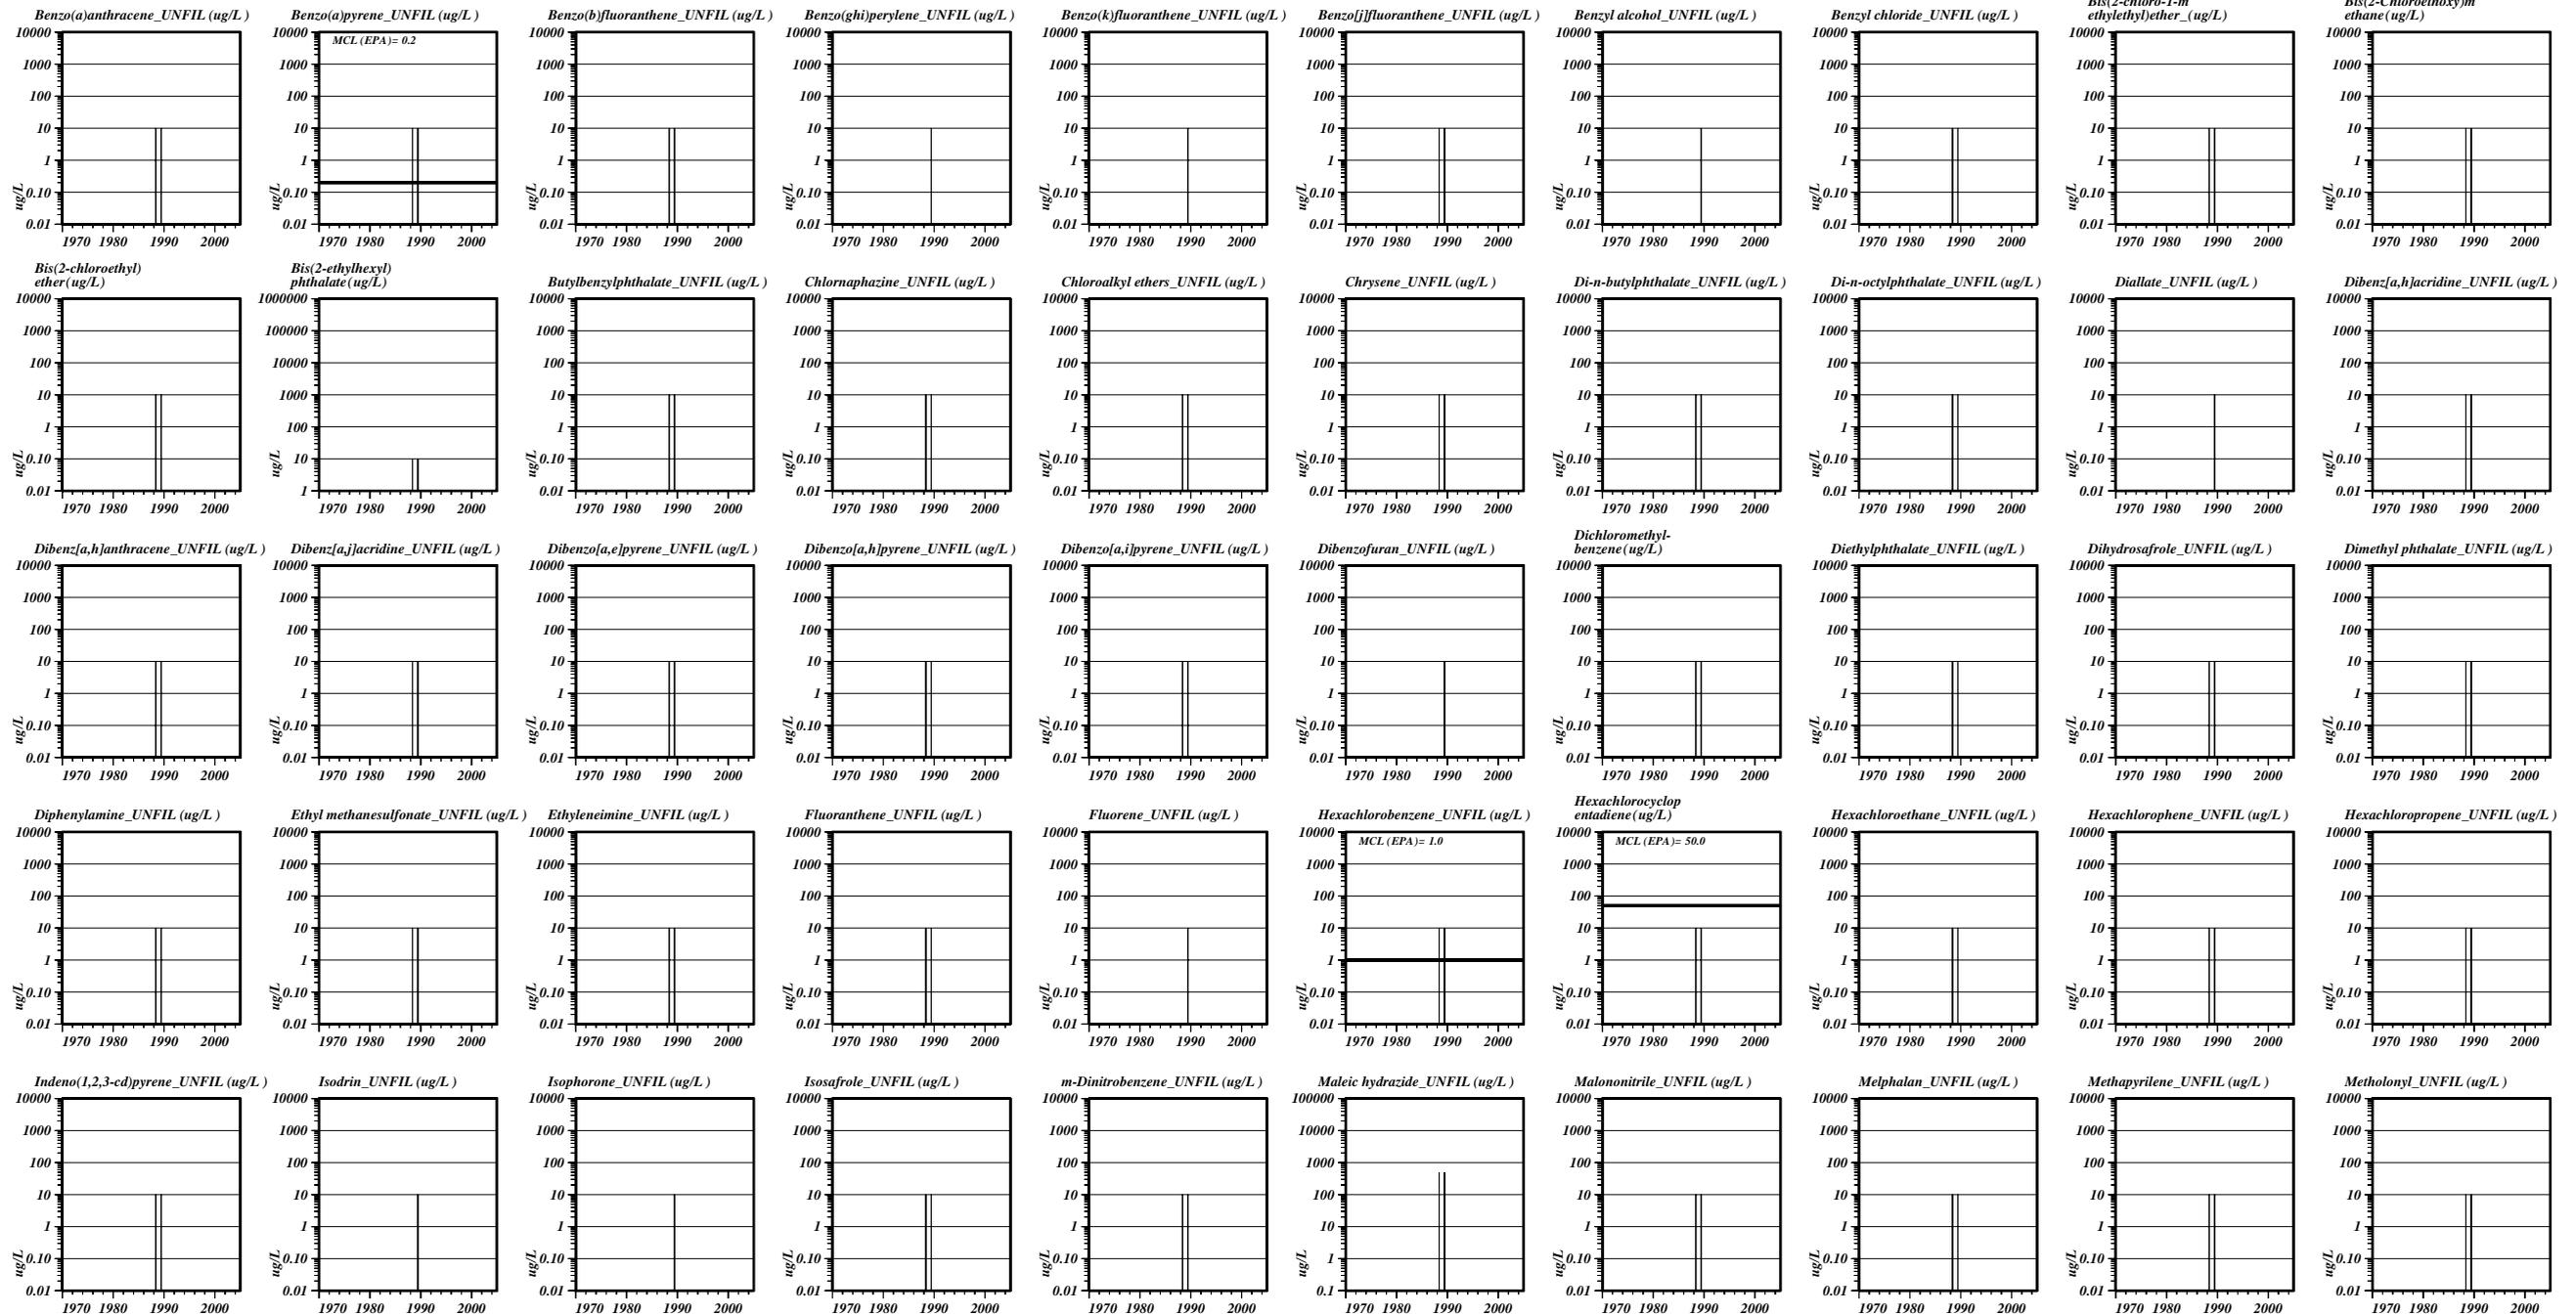

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag


SEMI-VOLATILE ORGANIC COMPOUNDS

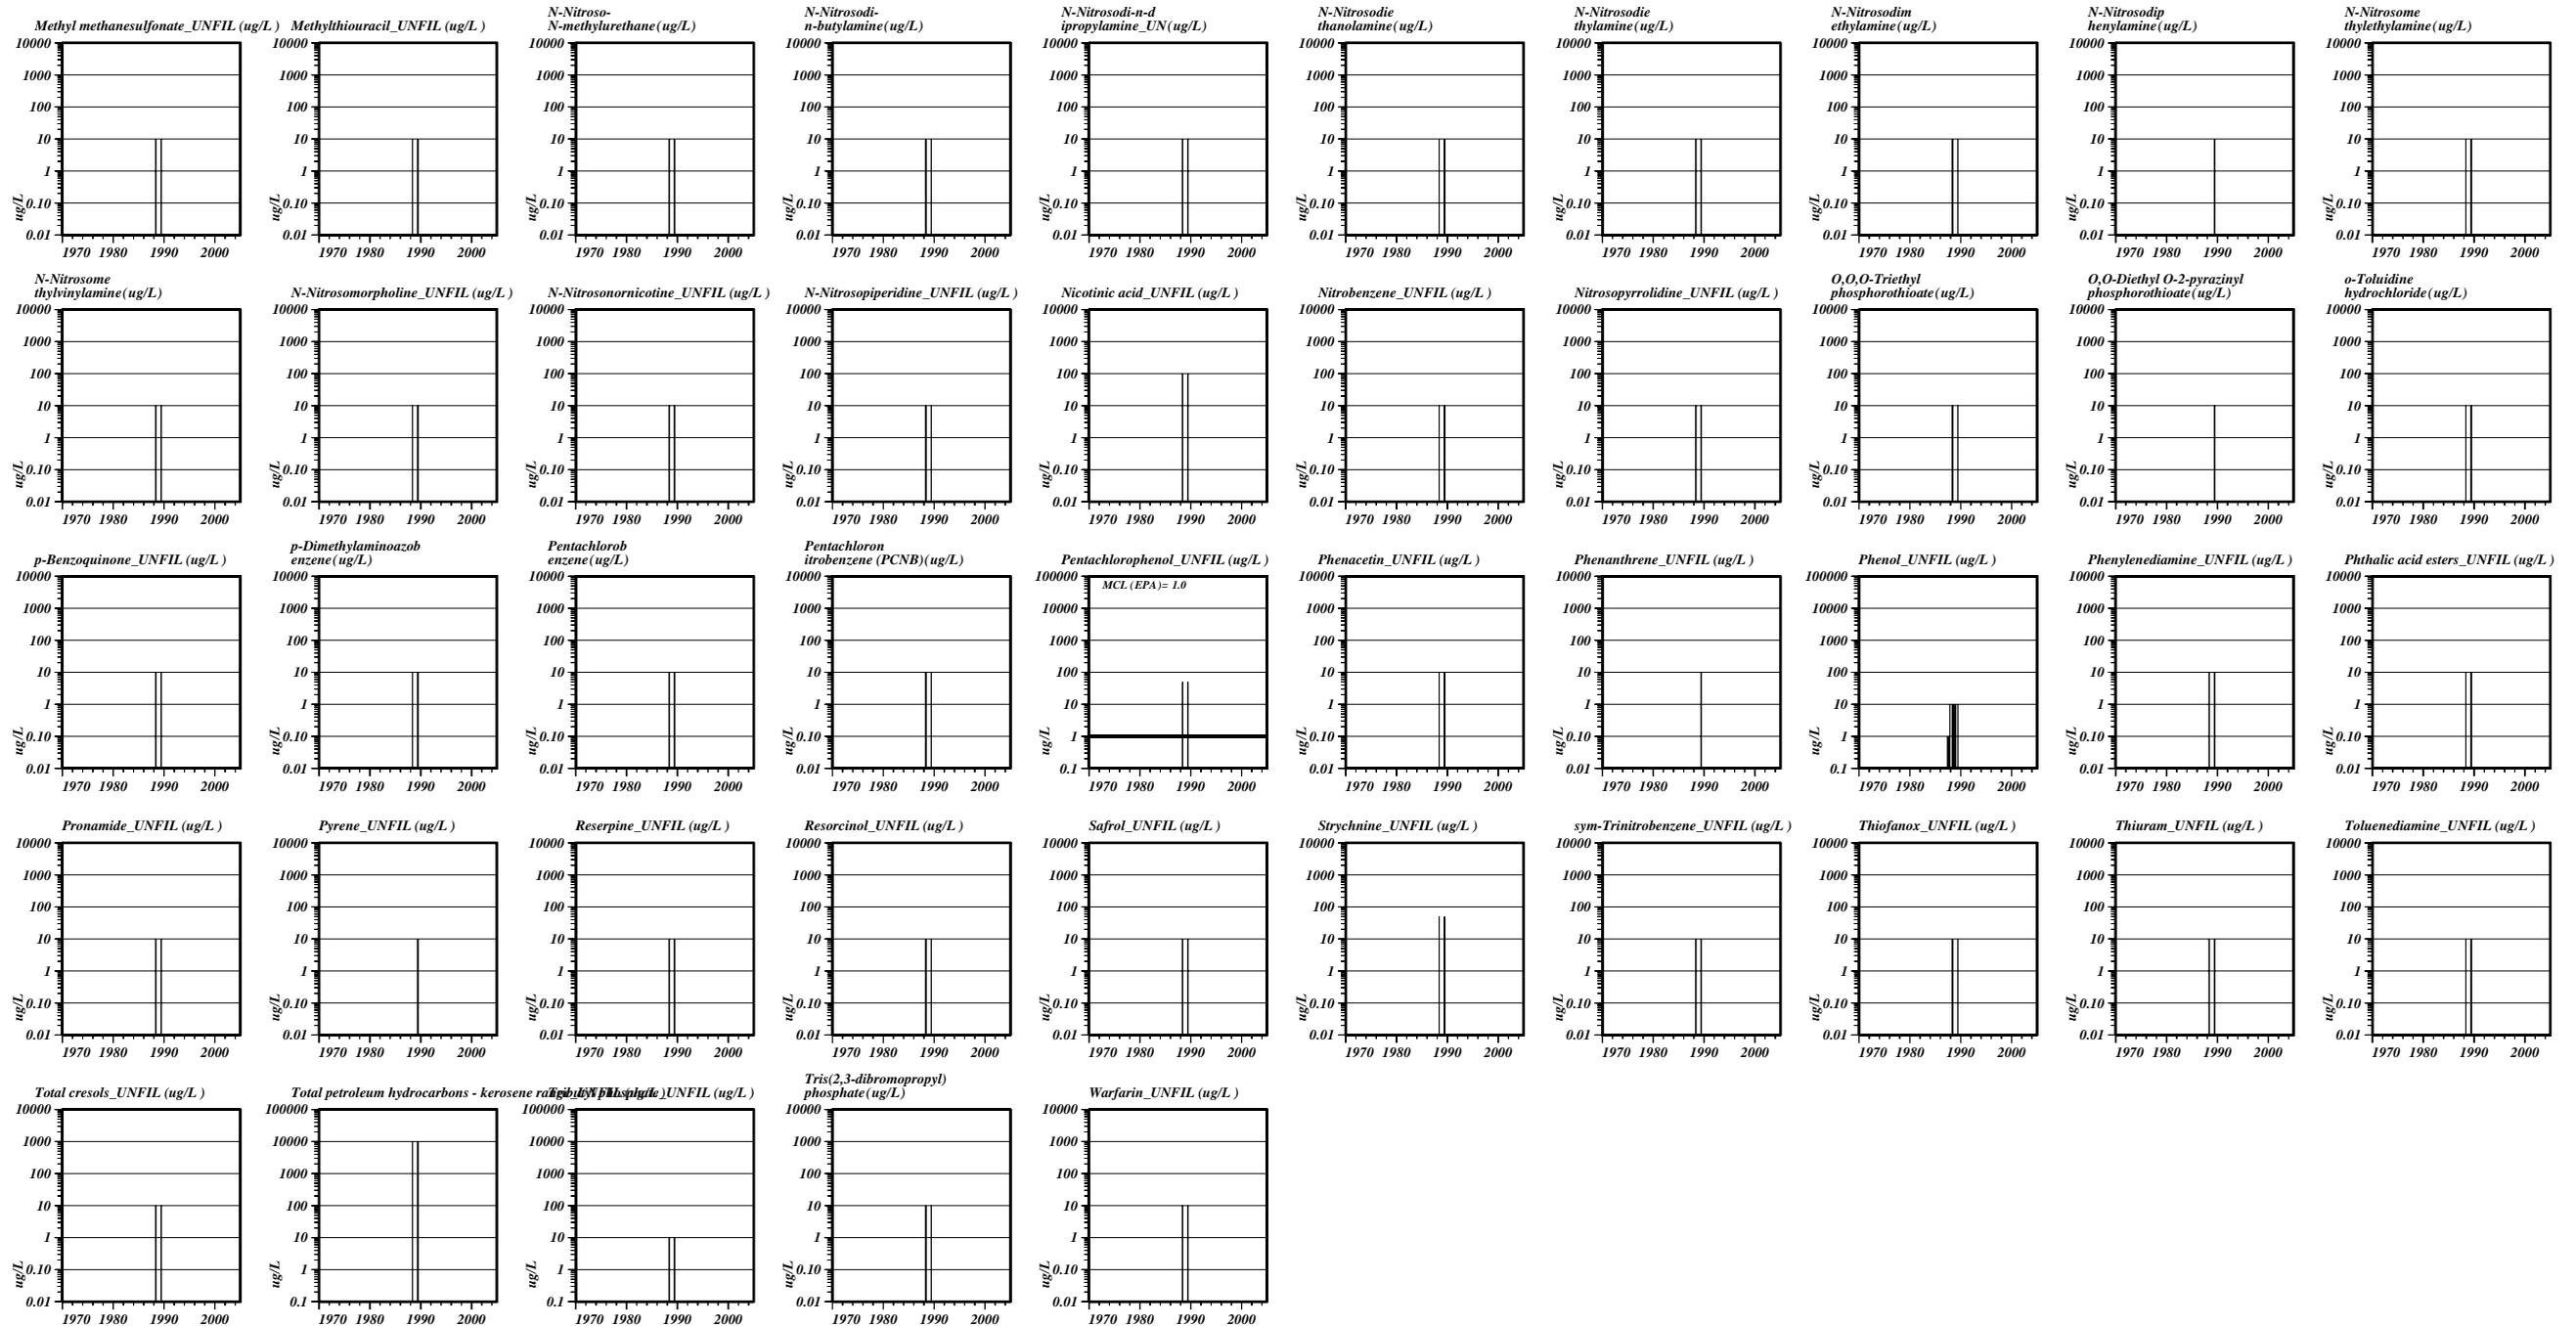

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag


METALS & PHYSICAL PARAMETERS

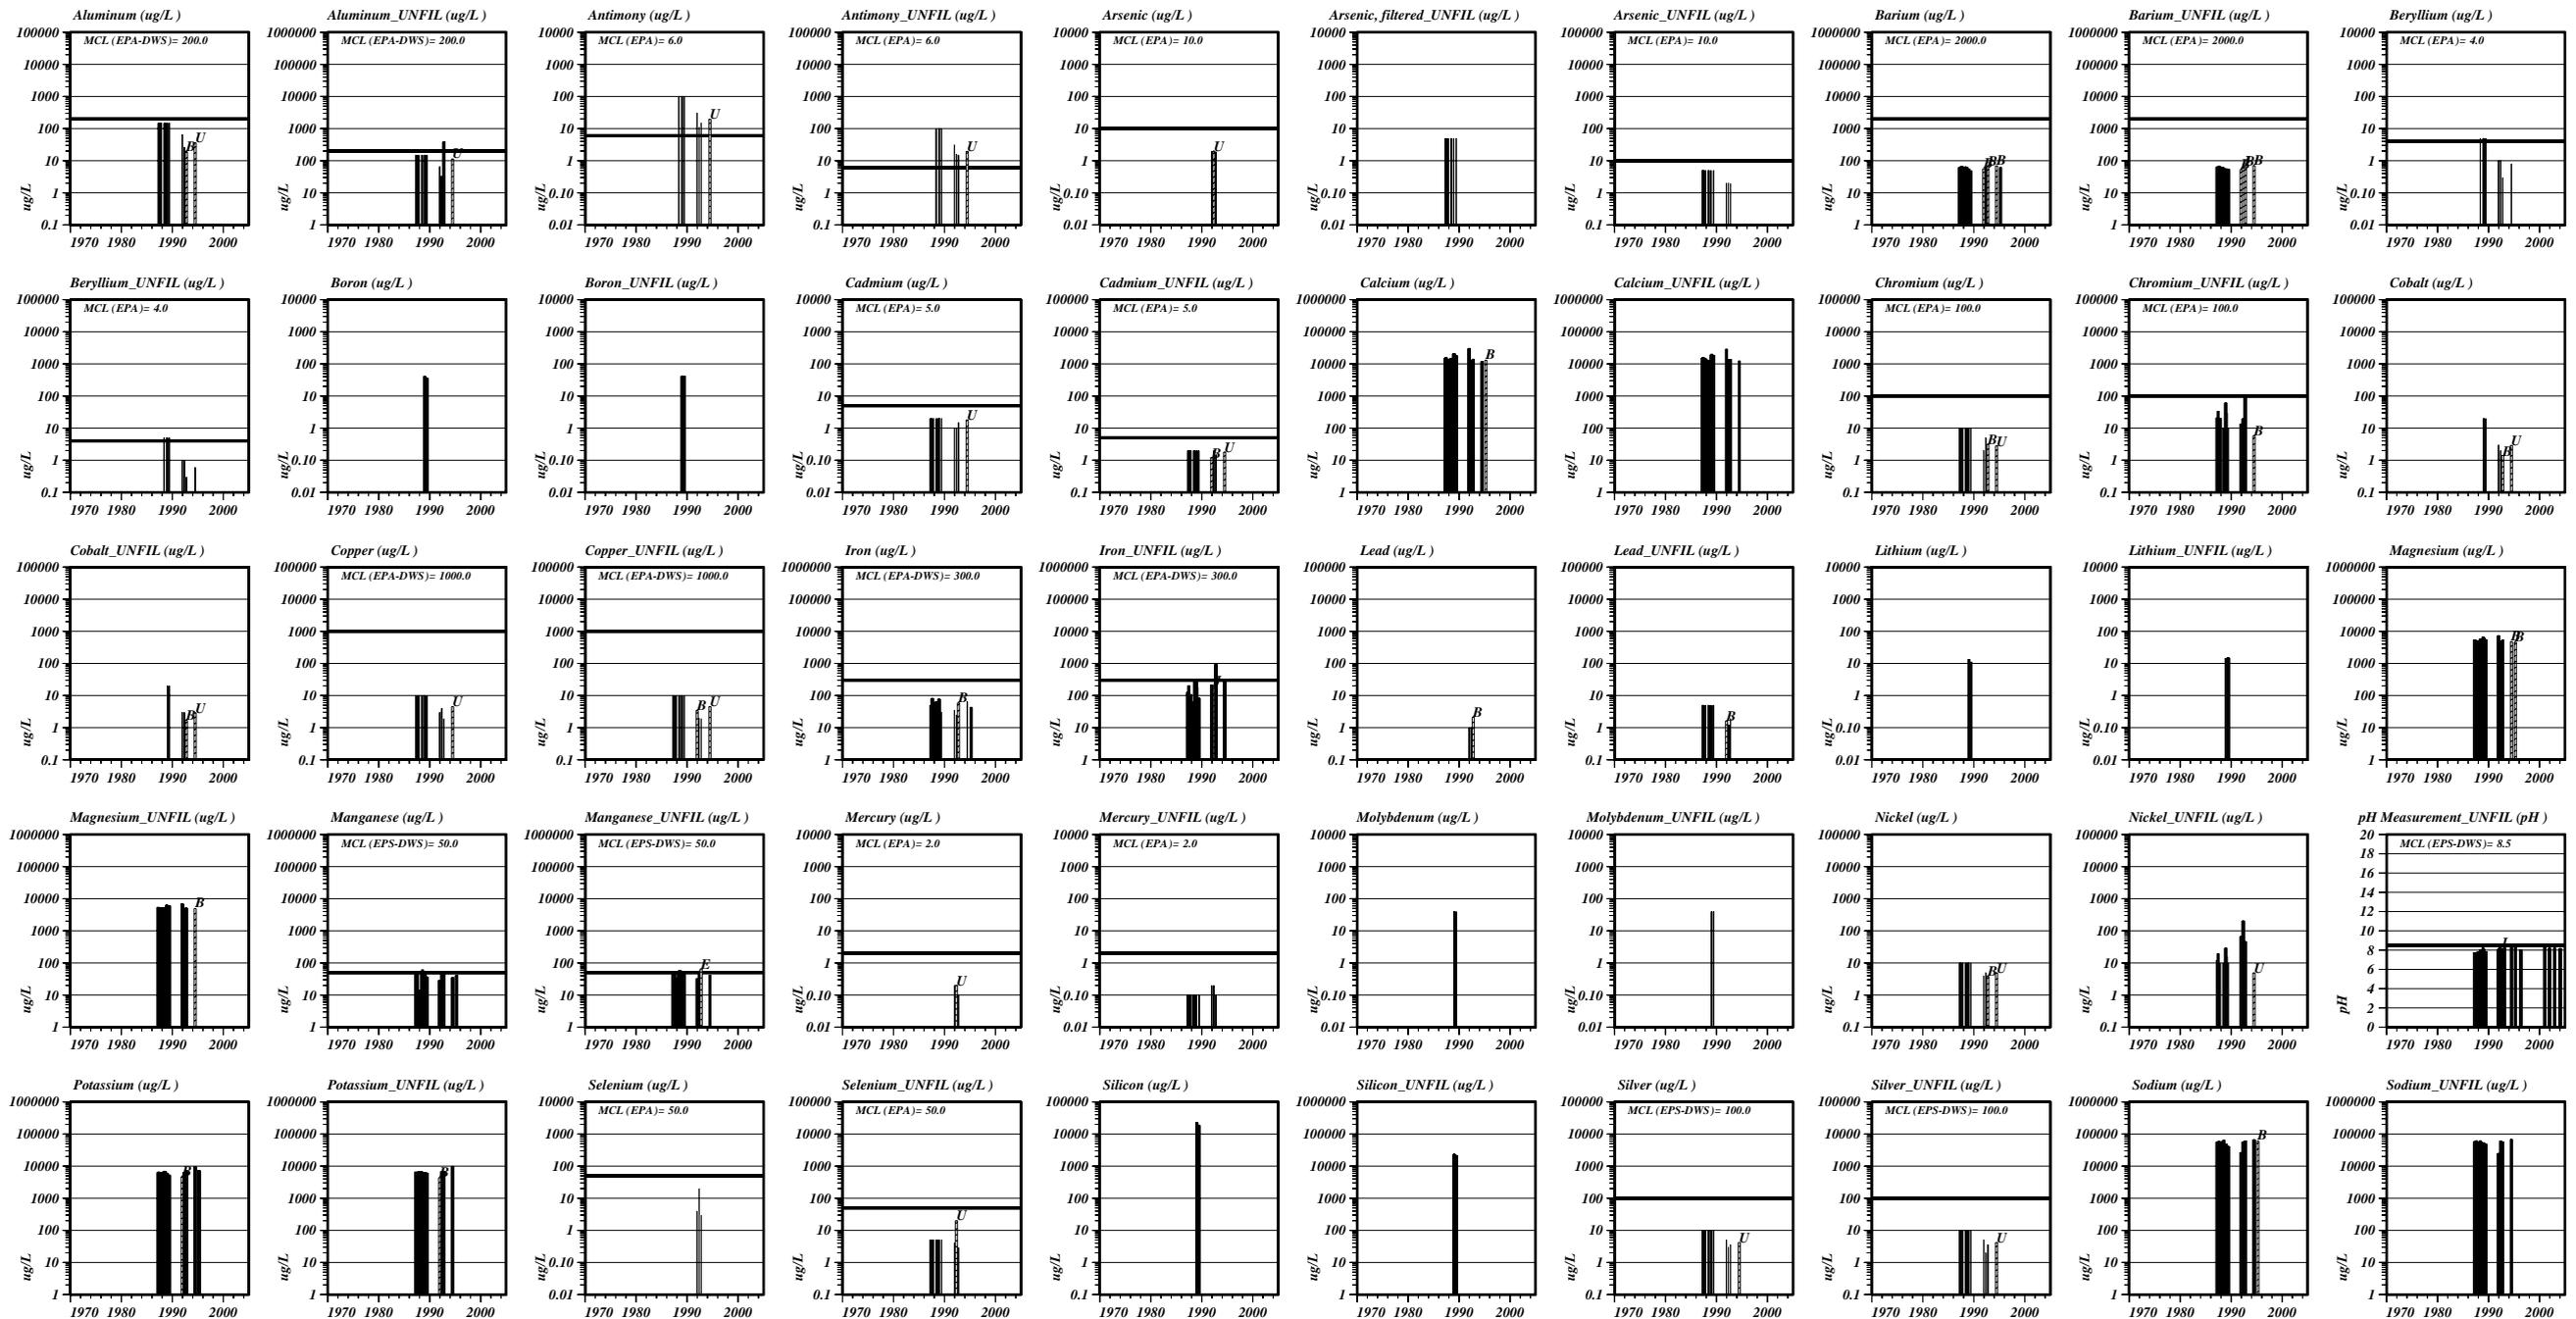


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value; L=Value between IDL and CRQL (estimated); T=Tentatively identified compound; EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit; THIN BARS=Value Below Detection Limit; HATCHED BARS=Value With Data Qualifier Flag

METALS & PHYSICAL PARAMETERS

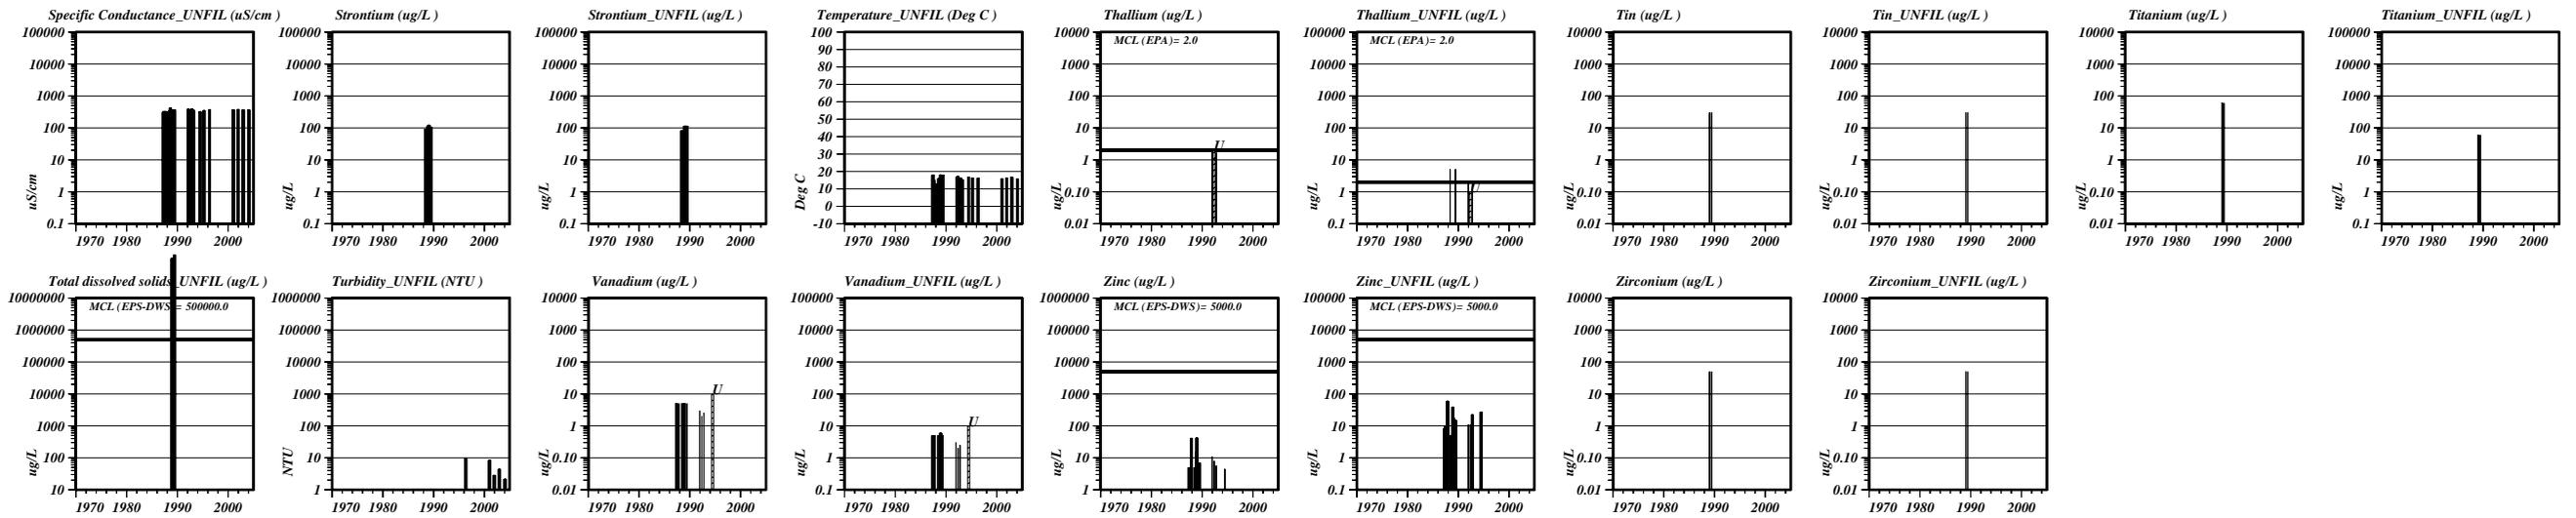


PEST/PCB, HERB, & DIOXINS

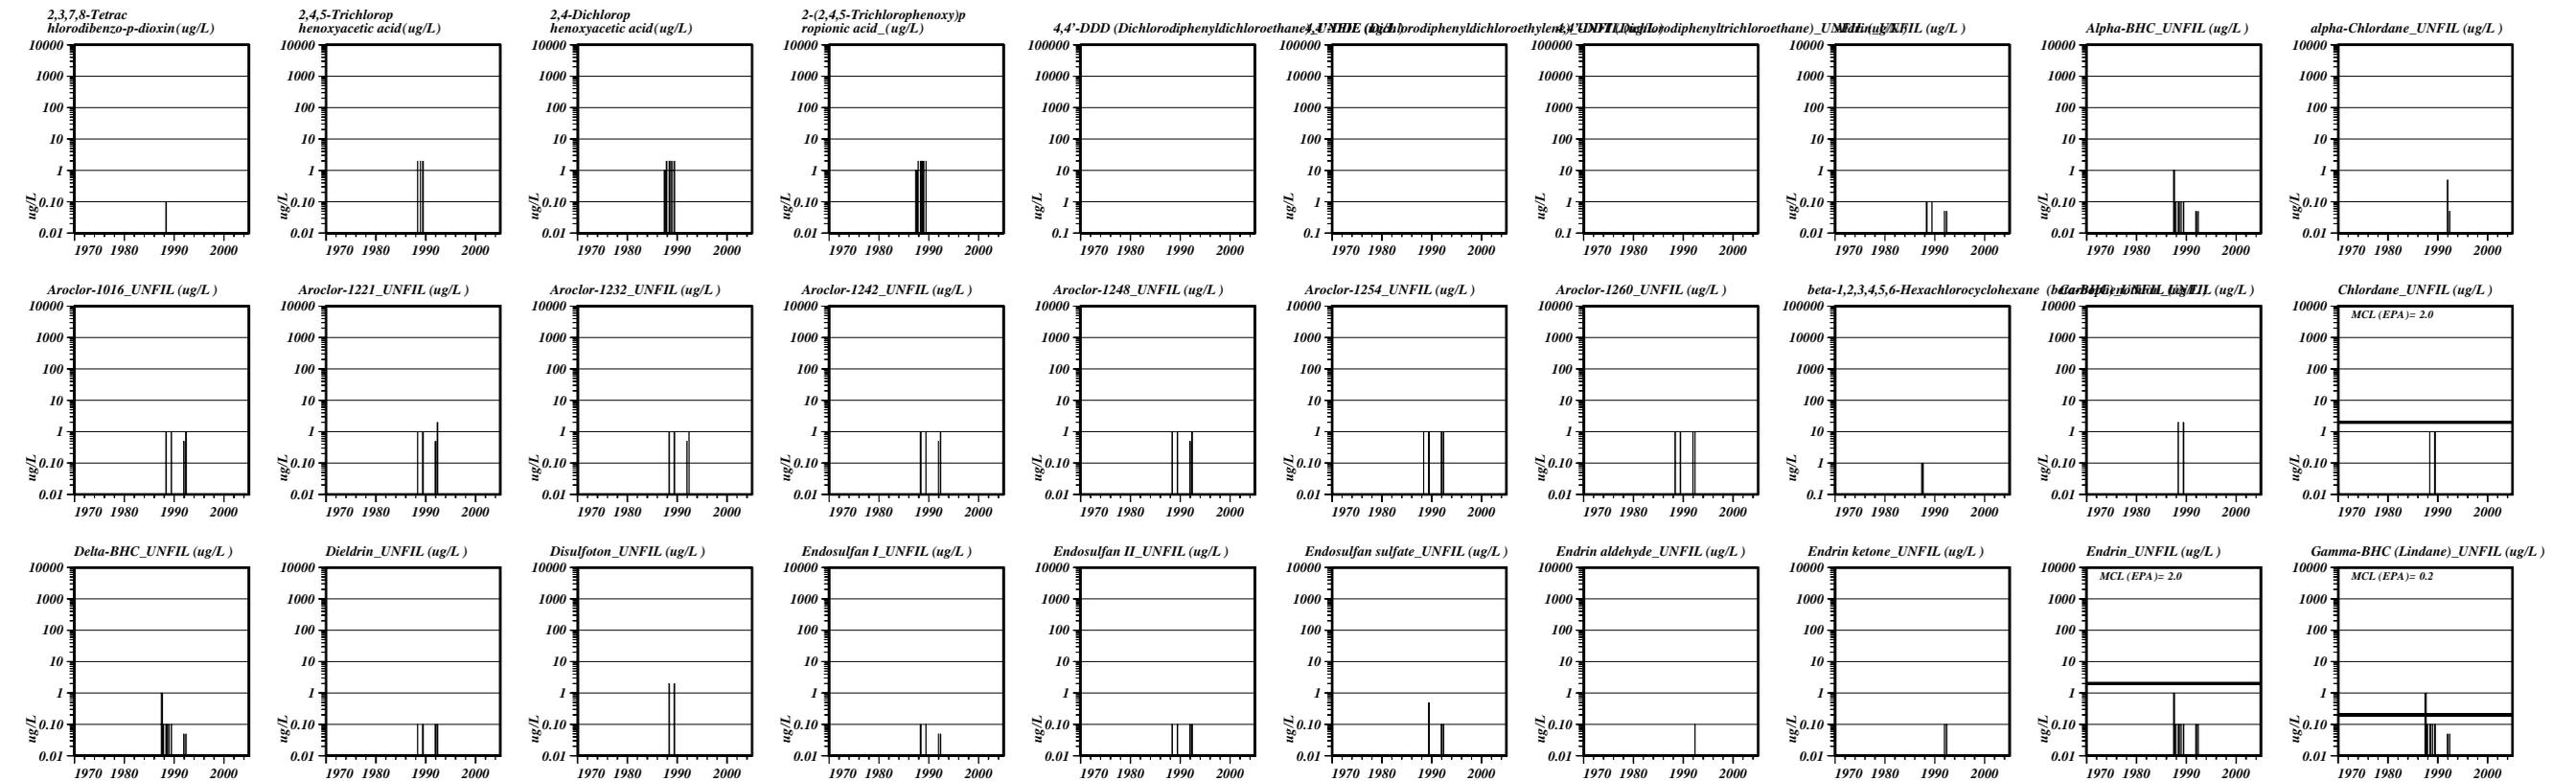


LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value;L=Value between IDL and CRQL (estimated);T=Tentatively identified compound; EPA-IGR=EPA-Implementation Guidance for Radionuclides; WAC=Washington Administrative Code;

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit;THIN BARS=Value Below Detection Limit;HATCHED BARS=Value With Data Qualifier Flag

PEST/PCB, HERB, & DIOXINS

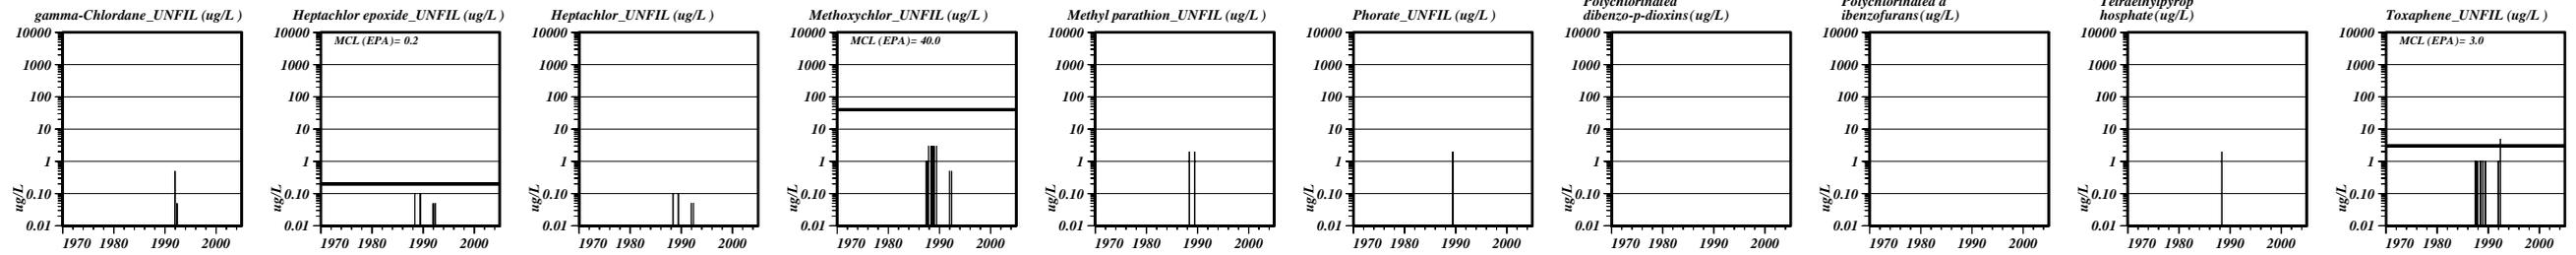

GENCHEM & ORGANICS & GENORGANICS

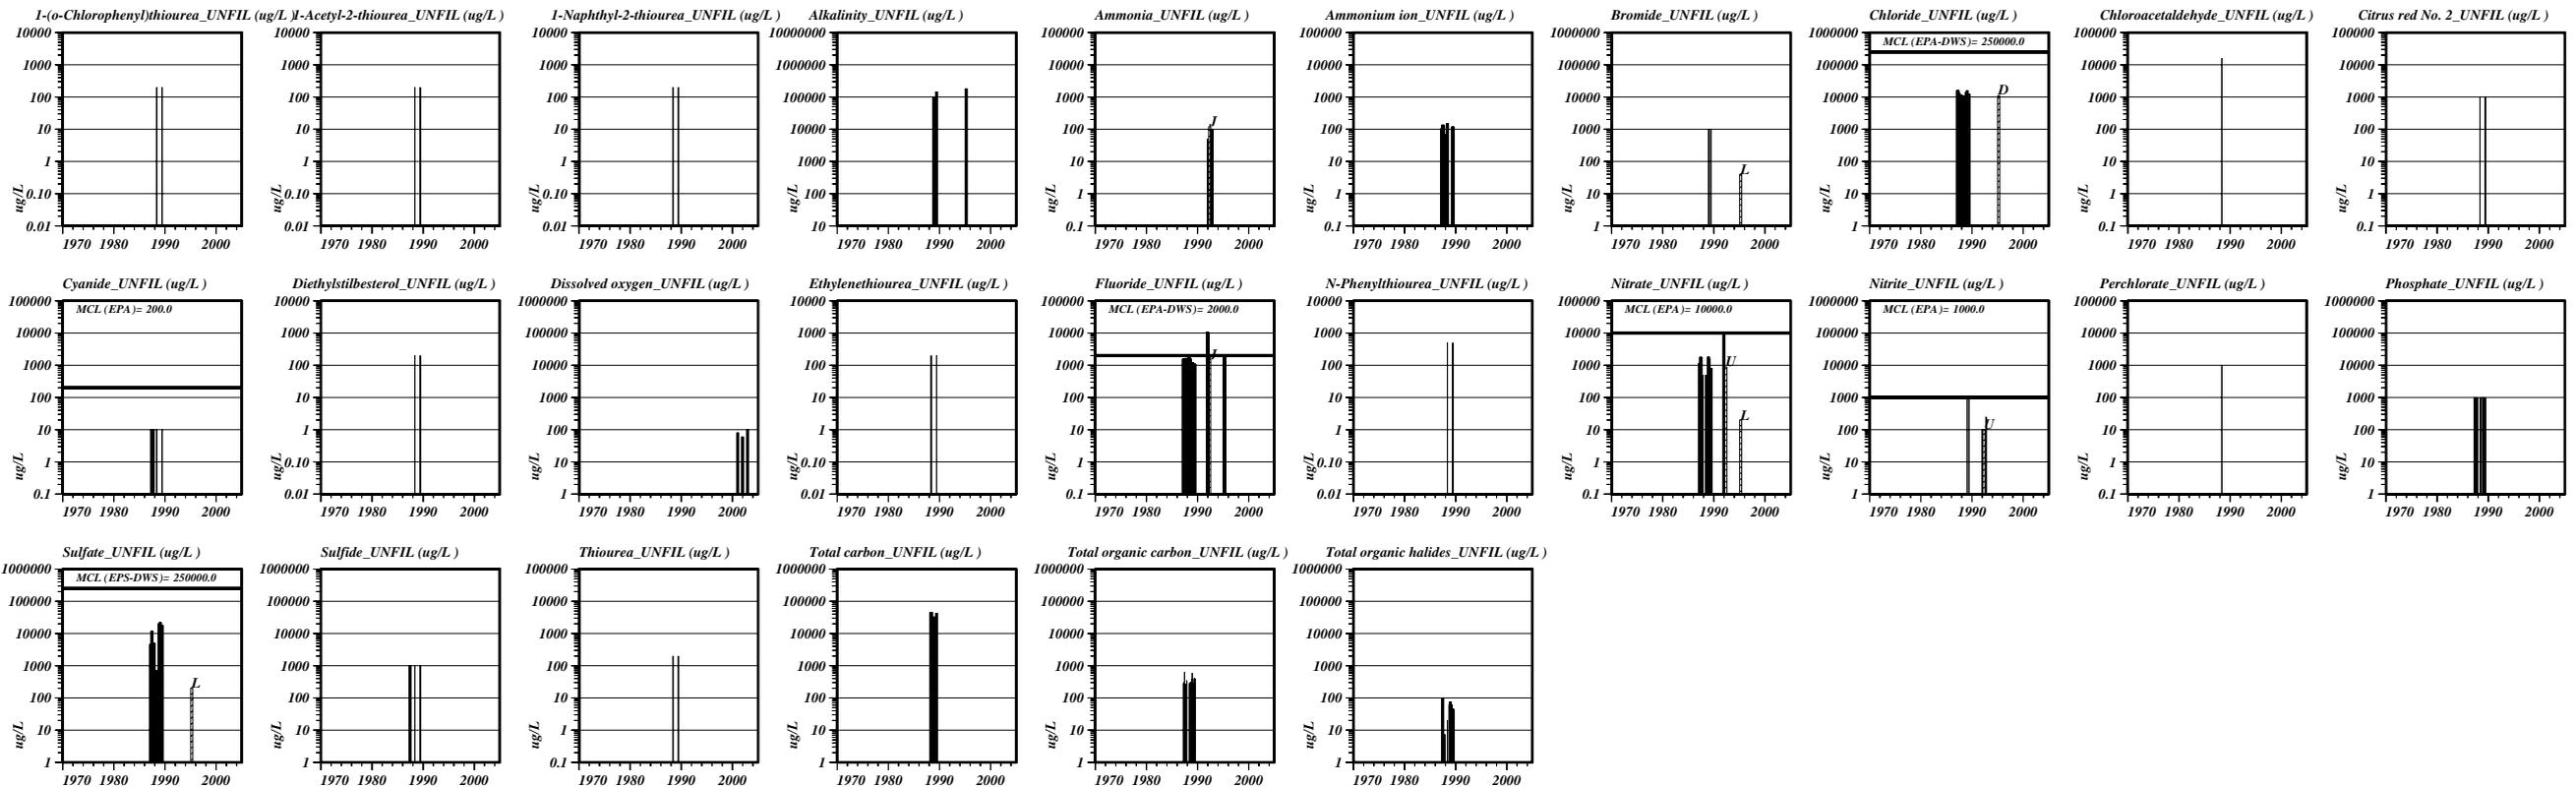

LABORATORY QUALIFIER FLAGS in HEIS are *, >, B, C, D, E, J, L, P, Q, R, W, X, Y, and Z: Review Document. Main Flags are : J=Estimated value:L=Value between IDL and CRQL (estimated):T=Tentatively identified compound:
 EPA-IGR=EPA-Implementation Guidance for Radionuclides: WAC=Washington Administrative Code:

EXPLANATION: THICK FILLED BARS=Value Above Detection Limit:THIN BARS=Value Below Detection Limit:HATCHED BARS=Value With Data Qualifier Flag